


POLYTERM® FLEXIBLE SMD TERMINATION

CHRISTOPHER ENGLAND APPLICATIONS ENGINEER / HVS PRODUCTS

Cracked capacitors can manifest themselves as latent defects including increased leakage current, intermittent opens, shorts or no problem found when field returned assemblies are analyzed. In some cases these defects can lead to catastrophic failure depending on the application energy available. Cracks could be introduced at virtually any point in the surface mount assembly process from pick and place, soldering and reflow, handling after assembly, depanelization, board level testing or equipment assembly (see below example of standard termination after flexing). Board flexure and handling are the predominant source of capacitor cracking. Polyterm® Flexible SMD Termination was developed to provide a flexible bond capable of withstanding higher physical strain than standard terminations. Standard terminations are more susceptible to cracking during processing, which may not be discovered by visual means. Over time these cracks can propagate into opposing electrodes within the capacitor possibly causing the capacitor to fail short, and subsequent catastrophic failure. Polyterm®, in addition to proper board layout practices, provides added protection and greatly reduces the possibility of the capacitor failing due to these board stresses.

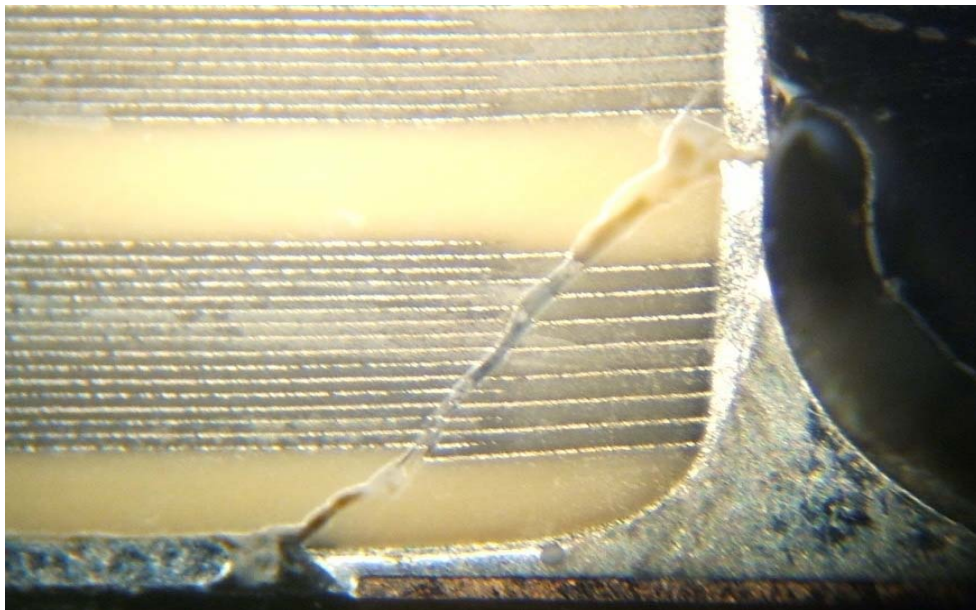

Performance verification of the Polyterm® flexible SMD termination was performed on the R15 (0805), R18 (1206), S41 (1210), S43 (1812), R29 (1808) AND S47 (2220) size capacitors. These tests were conducted based on industry standards. JIS-C-6429, IEC-384-1, IEC 60068-2-21.

TESTING PROCEDURE

Group 1) 80 samples and were subjected to gradual bending measured incrementally in 1 mm steps from 1mm to 10mm. A failure would be indicated by loss of capacitance >10% (JIS-C-6429). These samples were then removed from the board and the terminations were etched from the capacitor body. The ceramic body was then physically inspected for damage. Both Polyterm[®] and Standard terminations were subjected to this experiment. Each different part size is represented by the summary of test results (Figure 1) and a graph Showing cumulative failure of both Polymer and standard terminations (Figures 2-7)

Group 2) Samples were bent to varying degrees of deflection to provide photographic representation of how the polymer terminations perform and illustrate how failures manifest themselves. This test was performed using the S47 (2220) sample group (figures 8-12). One board for each mm of deflection was used.

SUMMARY OF TEST RESULTS

| X7R Dielectric | Mean Bend (mm) Standard Termination | Mean Bend (mm) Polyterm [®] | Component Flex Improvement With Polyterm [®] |
|-----------------|-------------------------------------|--------------------------------------|---|
| R15 0805 | 3.4 | 9.8 | +188% |
| R18 1206 | 3.3 | 9.1 | +175% |
| S41 1210 | 4.2 | 9.6 | +128% |
| S43 1812 | 3.9 | 8.9 | +128% |
| R29 1808 | 3.0 | 6.2 | +106% |
| S47 2220 | 3.8 | 6.7 | +75% |

Figure 1

COMPARISON OF STANDARD TERMINATION vs POLYTERM®

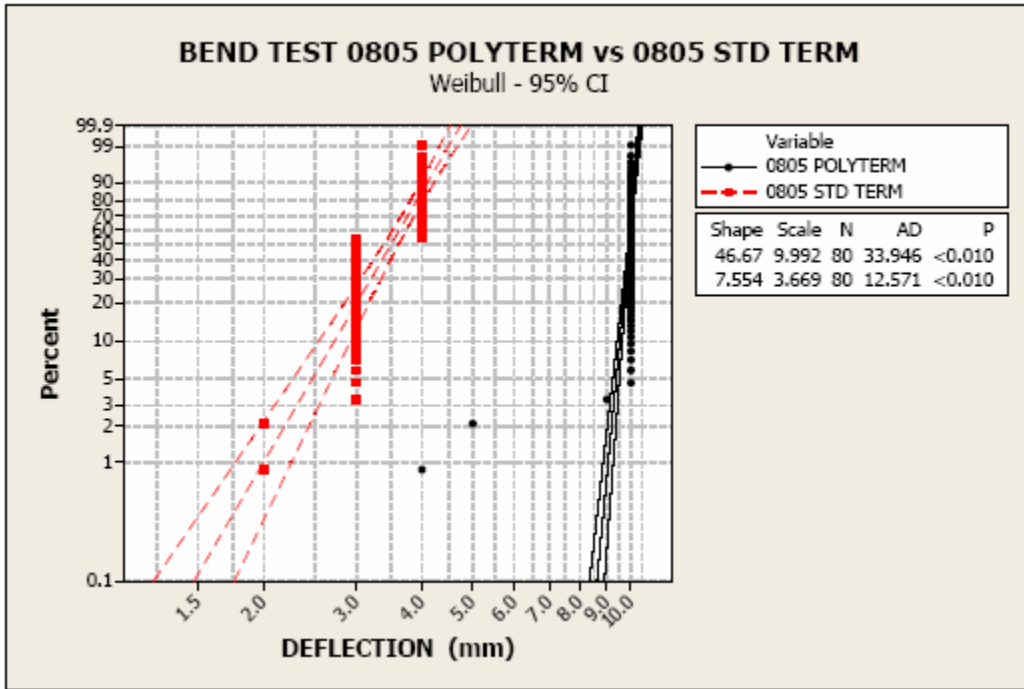


Figure 2

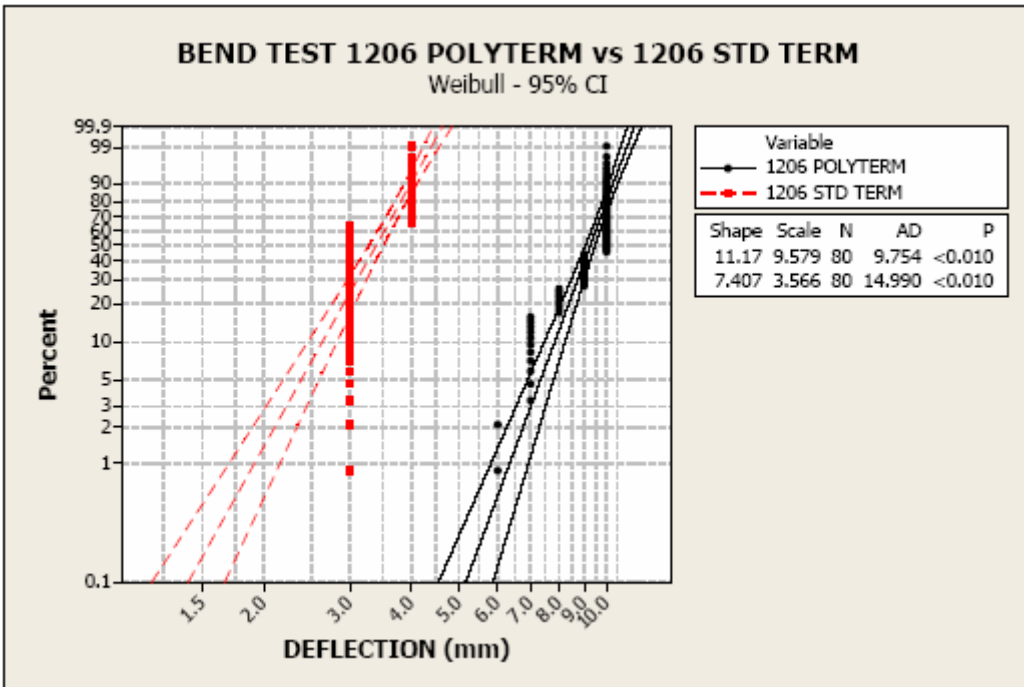


Figure 3

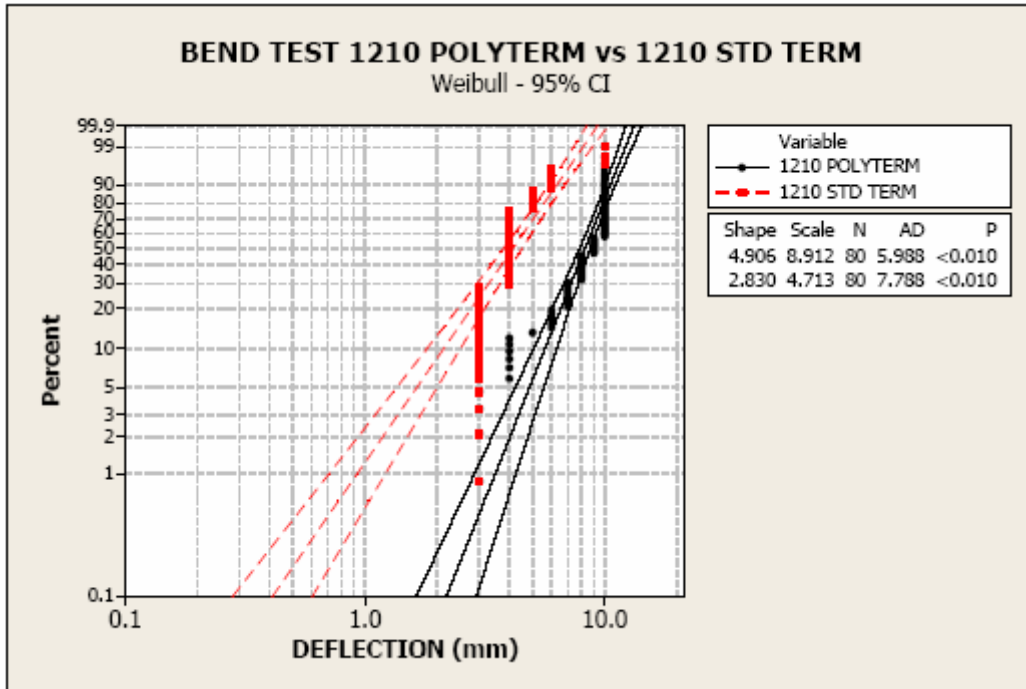


Figure 4

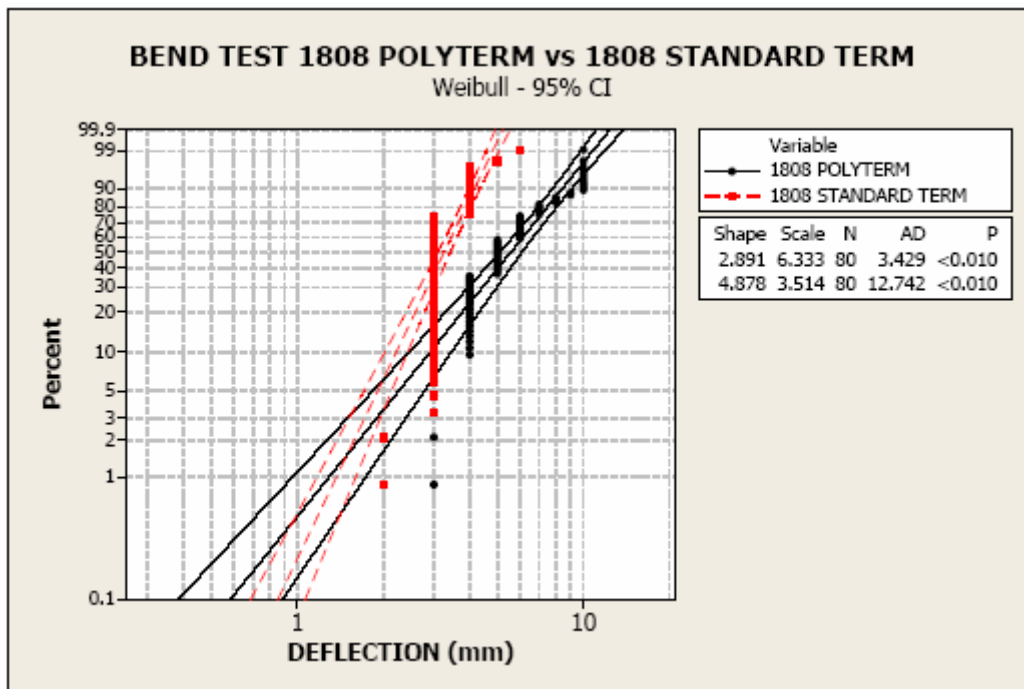


Figure 5

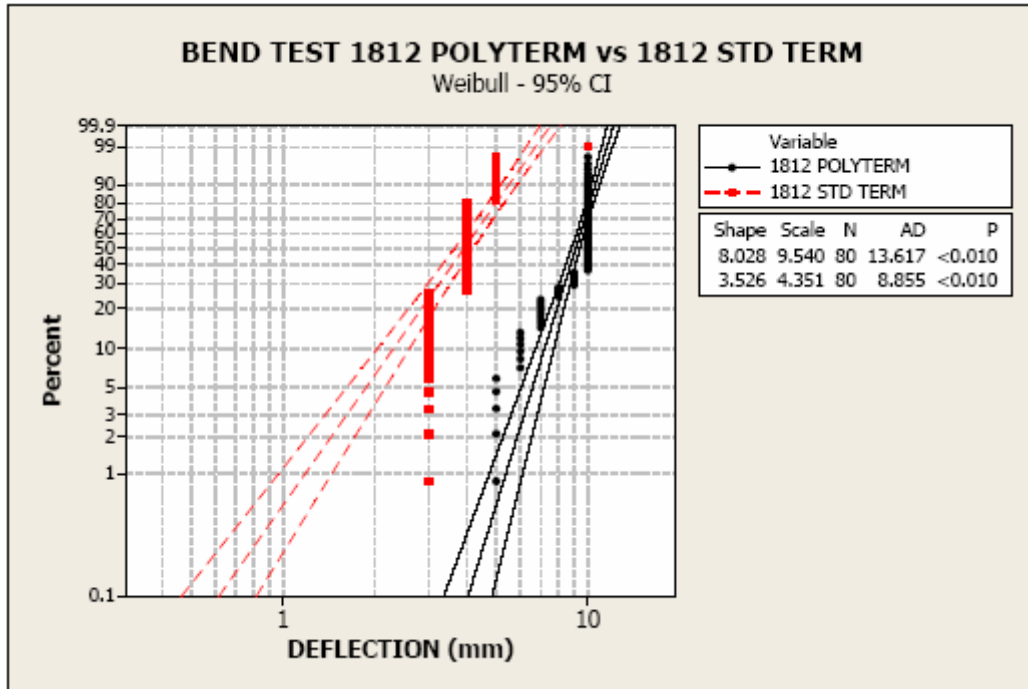


Figure 6

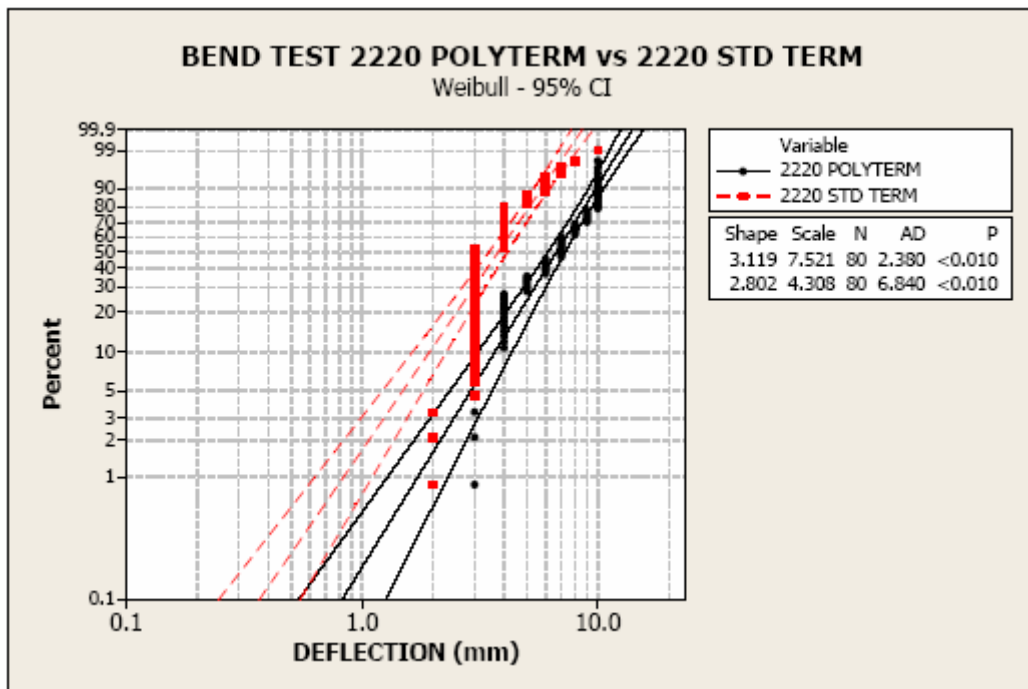


Figure 7

POLYTERM[®] CROSS SECTION ANALYSIS

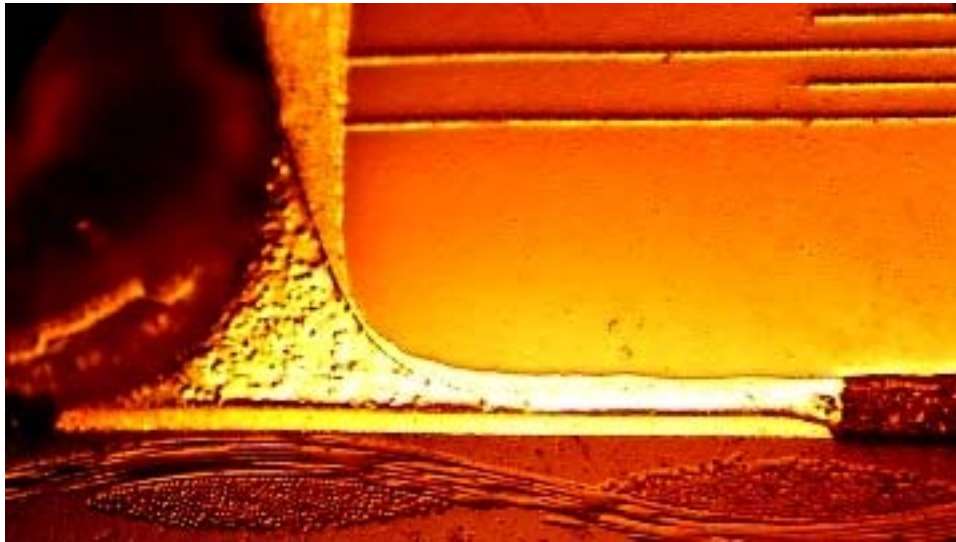


Figure 8 Undamaged Termination 1mm Deflection

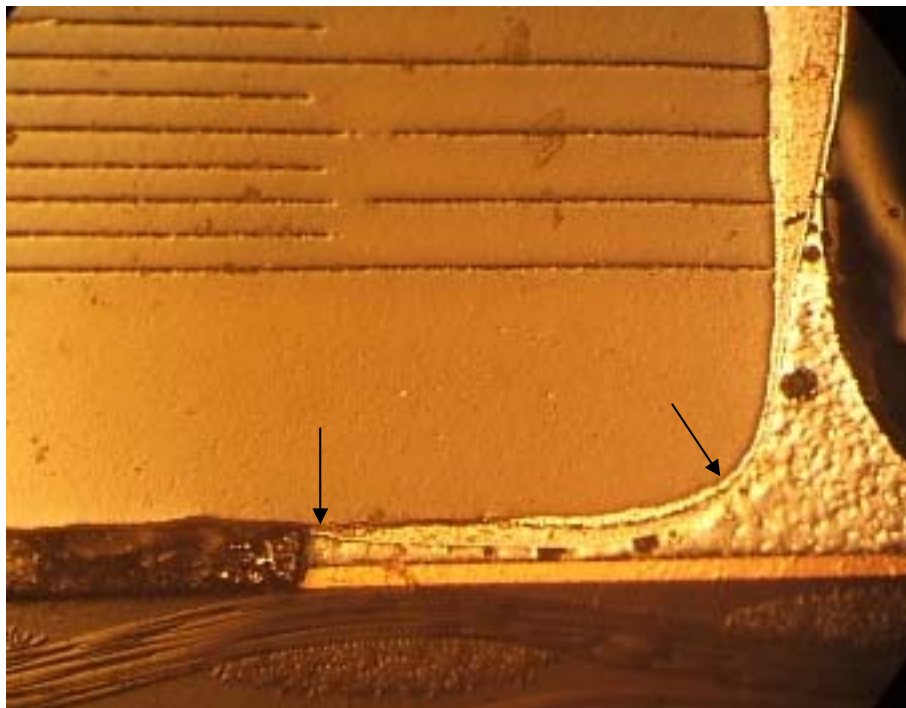


Figure 9 Partial Separation of Polymer 3mm deflection.

At 3mm only partial separation of the polymer was visible. The silver layer is clearly separating from the polymer with no ceramic damage visible.

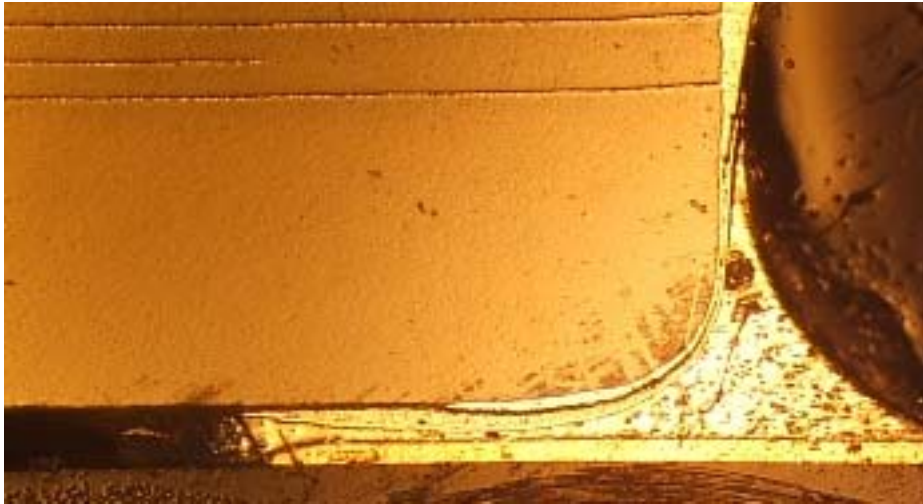


Figure 10 Partial Separation of Polymer 4mm

The photo in Figure 10 shows almost complete separation of the silver termination from the polymer layer. Although the polymer layer is partially separated the capacitor still operates normally. When returned to the original state all capacitors regardless of failure operated within specification.

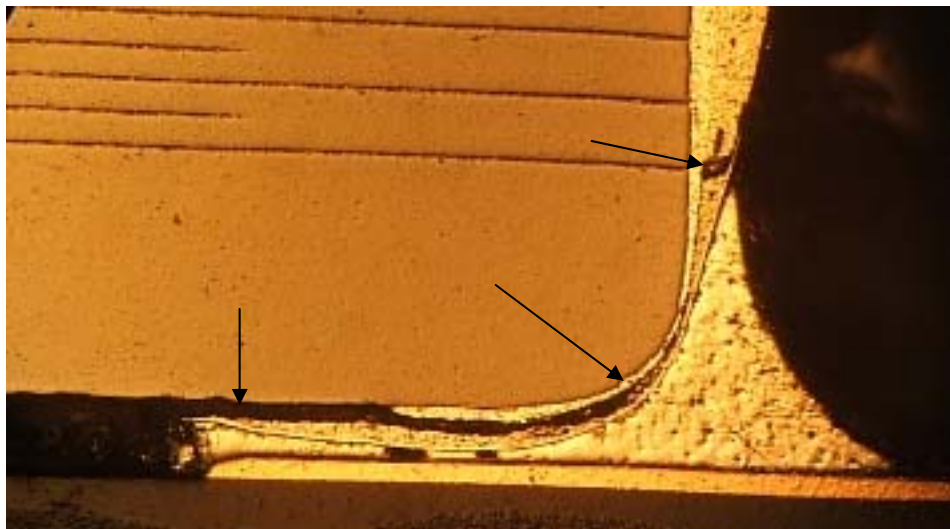


Figure 11 Complete Separation of Polymer Layer 5mm

Complete separation of the polymer layer may cause open capacitor, but ceramic failure was not observed. This will protect against the capacitor failing short causing catastrophic failure.

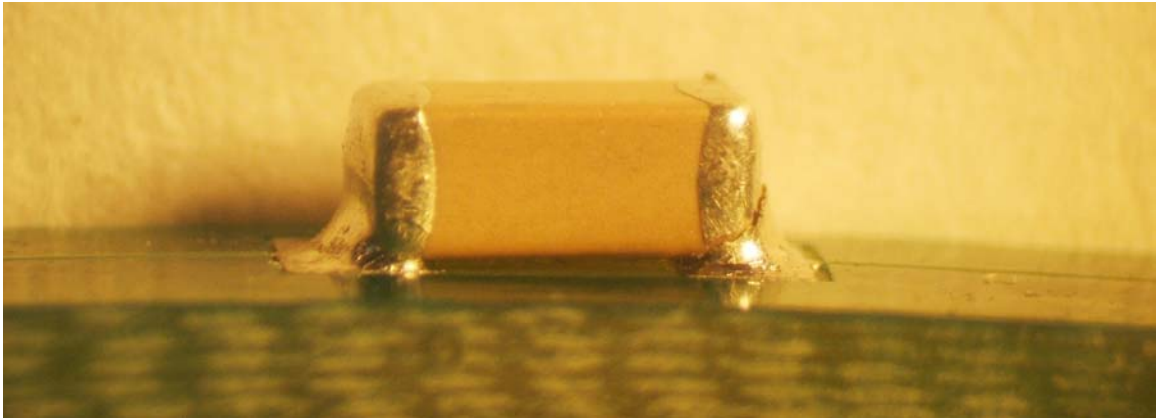


Figure 12 Capacitor with Complete Separation of Polyterm[®] Termination During Flex testing.

TEST BOARD AND FLEX TESTING EQUIPMENT


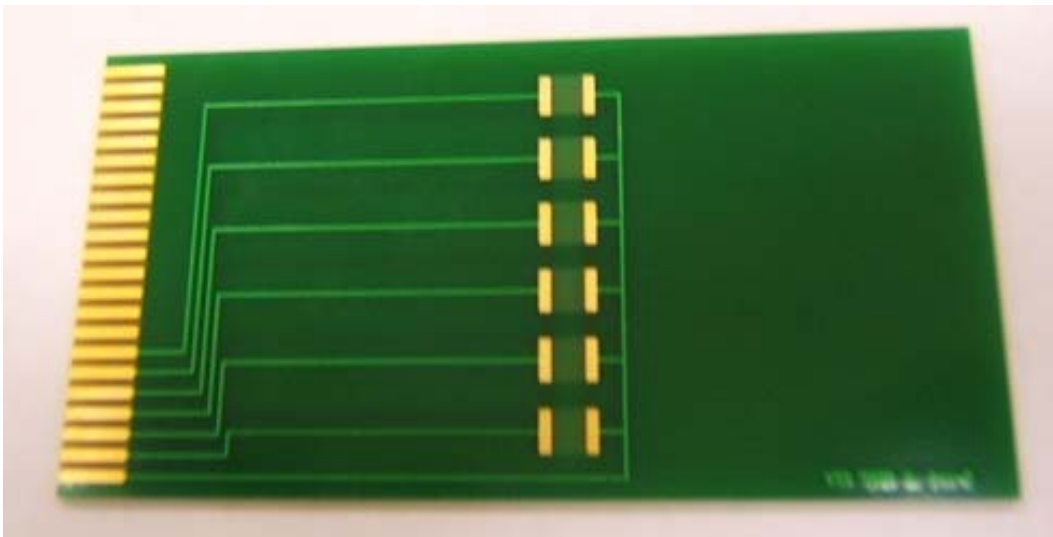


Figure 13 Flex Test Board



Figure 14 Flex Test Fixture W/CPU for Data Storage

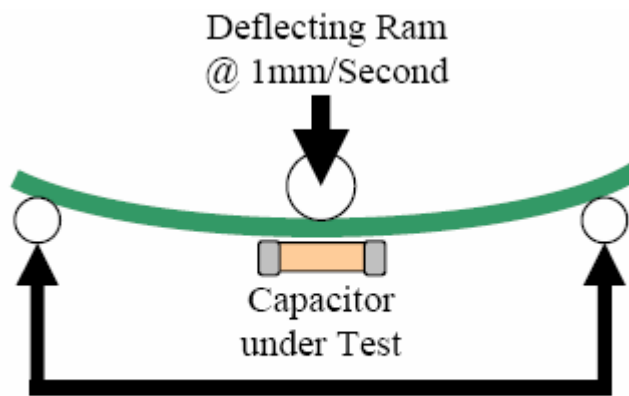

Support w/90mm Span
Figure 15 illustration of bend test

CONCLUSION

Polyterm[®] flexible SMD termination is useful in reducing or eliminating MLCC failures due to board flexing, and stresses related to board fabrication and assembly and operation. Although all components may exhibit some termination separation there was no degradation observed that would interfere with the capacitors operation or performance. Polyterm[®] in addition to proper board layout and handling can greatly reduce or eliminate failures associated with MLCC cracking.

Notice: Specifications are subject to change without notice. Contact your nearest Johanson Dielectrics, Inc. Sales Office for the latest specifications. All statements, information and data given herein are believed to be accurate and reliable, but are presented without guarantee, warranty, or responsibility of any kind, expressed or implied. Statements or suggestions concerning possible use of our products are made without representation or warranty that any such use is free of patent infringement and are not recommendations to infringe any patents. The user should not assume that all safety measures are indicated or that other measures may not be required. Specifications are typical and may not apply to all applications.